



Bruker Nano GmbH · Am Studio 2D · 12489 Berlin · Germany

Bruker Nano GmbH  
Am Studio 2D  
12489 Berlin  
Germany  
Tel. +49 (30) 670990-0  
Fax +49 (30) 670990-30  
info.bna@bruker.com  
www.bruker.com

Man. Eng.

Tel. - +49 30 670990

Fax - +49 30 670990

2019-12-17

## Inspection report

**XFlash SN:** 10093  
**RMA:** 30051247  
**Defect part:** SDD-Module  
**SN:** 280.126N  
**Date of production:** 2015-05-05  
**Date of inspection:** 2019-11-20  
**Failure Description:**

- Increasing leakage current Back- und RX-voltage
- Resolution decreasing
- Entrance Window contamination
- Structure destruction

Increasing leakage and structure destruction may be caused by a flashover of microscope

Entrance window contamination is a long term effect caused by condensing (mostly pump oil)

Bruker Nano GmbH